

## Membrane Pressing with KYDEX® 3D Laminates

TB-141-A

### Introduction

KYDEX® 3D thermoplastic laminates give designers the ability to incorporate compound corners and contoured edges, logos, and wire management holes while eliminating unsightly seams and the need for edgebanding typically associated with HPL/TFM surfaces. Its high impact resistance minimizes costly maintenance associated with other laminates.


3D molding presses allow three-dimensional components to be coated with films, foils, veneers and other moldable surface materials. The process consists of using a heated, elastic membrane, which is under pneumatic pressure, to apply a uniform pressure on a component, which is normally coated with an adhesive. The pressing process is supported by a vacuum. It allows molded parts, surfaces with molded cut-outs and edges to be coated three-dimensionally in one operation using heat. It is also a technique which guarantees a bubble-free bond.

### Membrane Pressing

#### Press Structure

The structure of a membrane press is sometimes described as a three-chamber system which is comprised of the following components:

- 1) The upper limit of the first chamber is the upper pressure plate and the lower limit is the membrane. The membrane, which is flexibly suspended, is brought up against the upper heating/pressure plate by a vacuum or by pressure in order to heat it up. A positive pressure is then formed which is used by the membrane to coat the work piece.
- 2) The top of the second, central chamber is formed by the membrane, while the bottom is formed by the inserted coating material. The coating and membrane are pulled together by a vacuum.

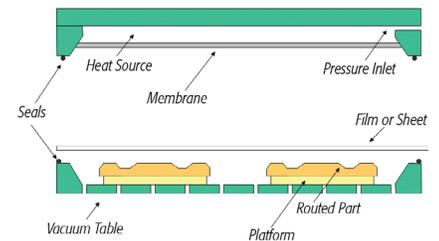


- 3) The top of the third chamber is formed by the coating, the bottom by the lower pressure plate. The work piece is placed in this chamber.

#### Substrate Material:

Medium density fiberboard, MDF, is characterized by an almost completely homogeneous structure and very low levels of swelling and shrinking: around 4% length- and width ways, and around 6% in its thickness. Because of its excellent surface quality, it is especially suitable for film-coating of broad and narrow molded surfaces. MDF is processed using conventional woodworking machines. When manufacturing furniture finishes, coatings are applied using the adhesives normally used in the woodworking industry. Dust-free, sanded surfaces and cleanly cut edges are essential for the quality of the coating. With MDF, edges and cuts in the broad surfaces are more absorbent than untreated surfaces. This must be taken into account when it comes to the adhesive, which must be applied particularly carefully in these areas.

#### Films:

Rigid polyvinyl chloride films (thermoelastic): an excellent coating material in molding press technology. PVC films are either used as a basis material and given a subsequent paint coating, or used as an outer, visible film. There are hardly any limits on the shapes that can be given to the work pieces. From deeply embossed or milled front-pieces, to polygonal table-tops with rounded edges, all the way to different shaped furniture knobs - anything can be coated. Coating materials can be between 0.15 mm (0.006in) and 5.0mm (0.12in) thick. The necessary thickness of the film depends on the roughness of the surface which is being coated, the distortion shapes, and the ways in which the finished part is to be used. PVC films begin to flow at around 70°C (158°F), while their ideal distortion characteristics are attained between 80 and 100°C, (176°-212°F). Contrary to public opinion, PVC film does not represent a health risk either in use or processing.

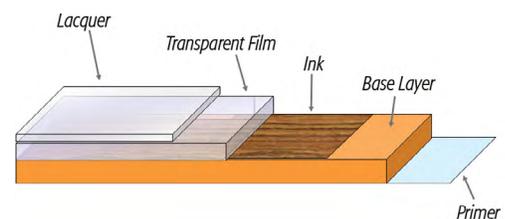

#### SEKISUI SPI

ISO 9001 and 14001 Certified

#### Customer Service

6685 Low St, Bloomsburg, PA 17815 USA  
 Phone: 800.325.5133, +1.570.389.5810  
 Outside the US: +1.570.389.5814  
 Fax: 800.452.0155, +1.570.387.7786  
 Email: info@sekisui-spi.com

#### Technical Service

Phone: 800.682.8758  
 Fax: +1.570.387.8722  
 Outside the US: +1.570.387.6997  
 techservice@sekisui-spi.com

[sekisui-spi.com](http://sekisui-spi.com)

## Membrane Pressing with KYDEX® 3D Laminates

TB-141-A


### Membrane Pressing (Continued)

#### Preparation:


- parts are clean and defect free
- adhesive is dry
- film is free of defects & dust
- proper pedestal size (thickness & relief)
- spacing between parts
- pre-vac
- proper time, temp, cooling (program)

#### How it works:


- 1) Parts are produced from MDF or HDF, (usually with panel saws and CNC routers), and then sprayed with adhesive and dried. The press is opened and the membrane is pulled onto the upper pressure plate by a vacuum for heating.
- 2) Next, the pallet, containing the work piece and covered by the coating, moves into the press. The press closes and hot compressed air separates the membrane from the heating plate.
- 3) The coating, stretched between the positioning frame and the upper spacer frame, is pulled onto the membrane by a vacuum; it continues to be heated by hot air from the upper chamber. A vacuum is produced in the lower chamber, and a simultaneous positive pressure in the upper; the membrane presses the coating material onto the surface of the work piece, and the heat passing directly through the membrane ensures that the adhesive is activated or cross-linked.
- 4) The temperature can reach 160°C (320°F) and the pressure a maximum of 8 bar (116 psi). After the pressing process, the membrane is separated from the coating by cold air and pulled back onto the upper plate by a vacuum, where it is heated up again. The press opens and the ready-coated work piece comes out.

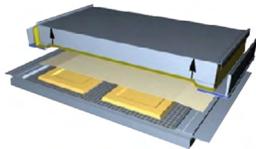


Step 1: the membrane is heated

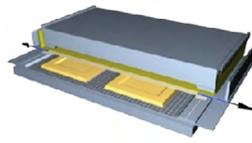

Step 2: the press is sealed and the preheat stage softens the sheet

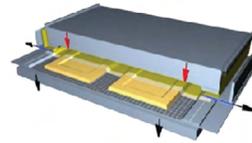

Step 3: pressure and vacuum occur while heat activates the adhesive

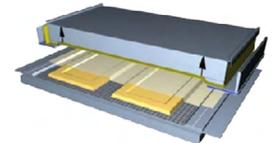

Step 4: the press cools and opens

### Considerations

Pre-Vacuum - evacuate expanding trapped air

Set Point Temp - target temp.

Soak Time - time at set point before vacuum

Press Time - time with vacuum and heat

Cool Time - time with vacuum only

Vacuum Level - verifies good cycle

Variables - substrate temp, film thickness, texture, color, environment, adhesive

#### Trimming and Post-Processing:

Rough cut parts & place on rack

Finish trimming while press cycles

"Lazy Susan" turnstile to aid in trimming

Automatic trimmers not viable for entry-level customers (cost)

#### Spacing of Molds:

Eliminate wrinkles, webbed corners, torn film & holes

Space products 2x to 3x part thickness

Use corner blocks on outside edges

200% stretch to tear

#### Pedestals/Pin Systems:

Pedestals allow vinyl to wrap

Pedestal height ~ = product height

Pedestal relief ~ = 3.2 - 6.4mm (0.126-0.252in)

Pin systems vs. pedestals

Pin systems not viable for entry level customers (cost)

#### SEKISUI SPI

ISO 9001 and 14001 Certified

#### Customer Service

6685 Low St, Bloomsburg, PA 17815 USA

Phone: 800.325.5133, +1.570.389.5810

Outside the US: +1.570.389.5814

Fax: 800.452.0155, +1.570.387.7786

Email: info@sekisui-spi.com

#### Technical Service

Phone: 800.682.8758

Fax: +1.570.387.8722

Outside the US: +1.570.387.6997

techservice@sekisui-spi.com

sekisui-spi.com

## Membrane Pressing with KYDEX® 3D Laminates

TB-141-A

**Wemhoener  
Technical  
Specifications**

**Pressing temperatures:** smoothly adjustable up to 160°C (320°F)

**Pressure:** up to 8 Bar (116 psi)

**Vacuum:** up to 100 mbar (0.0015 psi)

**Pressing times:** regulated by a timer. Pressing times are around 40 seconds for thermoplastic films.

**Work piece dimensions:** min. 30 x 30 mm (1.18 x 1.18in) max. 1,000 x 2,000 mm (39.4 x 78.7in)

**Work piece height:** up to 100 mm (3.94 in) or on request

**Work piece shape:** flattened, concave, convex, polygonal, etc.

### Recommendations

#### Press Settings:

The following conditions are based on 0.56mm (0.022in) material:

	Pre-Blowing Time (s)	Pre-Heating Time (s)	Pressing Time (s)	Cooling Time (s)	Top Heater Temperature	Bottom Heater Temperature	Pressure
Friz	1 second	45-55 seconds	40-50 seconds	35-45 seconds	130-140°C 266-284°F	131-149°C 55-65°F	2 Bars (29 psi)
Italpresse	1 second	80-90 seconds	55-65 seconds	30-40 seconds	115-130°C 239-266°F	-	2 Bars (29 psi)
Wemhoener	1 second	45-55 seconds	45-55 seconds	30-40 seconds	130-150°C 266-302°F	-	2 Bars (29 psi)

The following conditions are based on 0.71mm (0.028in) material:

	Pre-Blowing Time (s)	Pre-Heating Time (s)	Pressing Time (s)	Cooling Time (s)	Top Heater Temperature	Bottom Heater Temperature	Pressure
Friz	1 second	90 seconds	65-75 seconds	60 seconds	130-140°C 266-284°F	131-149°C 55-65°F	2 Bars (29 psi)
Italpresse	1 second	120 seconds	65-75 seconds	60 seconds	115-130°C 239-266°F	-	2 Bars (29 psi)
Wemhoener	1 second	90 seconds	65-75 seconds	90 seconds	130-150°C 266-302°F	-	2 Bars (29 psi)

The following conditions are based on 1.0mm (0.040in) material:

	Pre-Blowing Time (s)	Pre-Heating Time (s)	Pressing Time (s)	Cooling Time (s)	Top Heater Temperature	Bottom Heater Temperature	Pressure
Friz	1 second	120 seconds	85-95 seconds	110 seconds	130-140°C 266-284°F	55-65°C 131-149°F	2 Bars (29 psi)
Italpresse	1 second	180 seconds	85-95 seconds	110 seconds	115-130°C 239-266°F	-	2 Bars (29 psi)
Wemhoener	1 second	120 seconds	85-95 seconds	110 seconds	130-150°C 266-302°F	-	2 Bars (29 psi)

**SEKISUI SPI**  
ISO 9001 and 14001 Certified

**Customer Service**  
6685 Low St, Bloomsburg, PA 17815 USA  
Phone: 800.325.3133, +1.570.389.5810  
Outside the US: +1.570.389.5814  
Fax: 800.452.0155, +1.570.387.7786  
Email: info@sekisui-spi.com

**Technical Service**  
Phone: 800.682.8758  
Fax: +1.570.387.8722  
Outside the US: +1.570.387.6997  
techservice@sekisui-spi.com

[sekisui-spi.com](http://sekisui-spi.com)

## Membrane Pressing with KYDEX® 3D Laminates

TB-141-A

### Recommendations

#### Membrane and Lamination Press Manufacturers

Company Name	Phone	Web
Shaw-Almex	404-294-0574	www.almex-online.com
Italpresse SpA	US: 888-743-8505 Italy: +39-035-681122	www.italpresse.com
Wemhoener	+49-5221-77020	www.wemhoener.de
Orma Equipment	+39-035-346290	www.ormamacchine.it
Stiles Equipment Distributor of Wemhoener and Friz Machinery	616-698-7500	www.stilesmachinery.com
Friz Presses	+49-0-7441-58-0	www.friz.de
Euro-Mercury Presses	353-85-7039544	www.euro-mercury-presses.ie
Burkle Presses	+49-0-7441-58-0	www.burkleusa.com
Midwest Group One Distributor of Greco and Orma Equipment	612-721-5347	www.midwestgroupone.com

#### Adhesives:

##### PU dispersions:

Use: thermoplastic films

Processing: mostly single component (self-cross-linkers) or two-component (isocyanate cross-linkers)

Characteristics: very good strength levels

##### EVA dispersions:

Use: thermoplastic films

Processing: mostly two-component (isocyanate cross-linkers)

Characteristics: moderate strength

*Many PVC adhesives work well with KYDEX® sheet.*

Name	Company	Phone	Web
Helmibond 854 with catalyst #552	Helmitin Adhesives	800-634-8761	www.helmitinadhesives.com
JOWAPAR 151 00	Jowat Adhesives	800-322-4583	www.jowat.com
Bostik 7132R/Boscodur 24T	Bostik	414-774-2250	www.bostik.com
Daubond 6429	Daubert Chemical	800-688-0459	www.daubertchemical.com
RD-4000-B	H.B. Fuller	888-423-8553	www.hbfuller.com
Vy-Lok 1011 with hardener IS205	National Starch & Chemical	800-797-4992	www.nationaladh.com

#### SEKISUI SPI

ISO 9001 and 14001 Certified

#### Customer Service

6685 Low St, Bloomsburg, PA 17815 USA

Phone: 800.325.3133, +1.570.389.5810

Outside the US: +1.570.389.5814

Fax: 800.452.0155, +1.570.387.7786

Email: info@sekisui-spi.com

#### Technical Service

Phone: 800.682.8758

Fax: +1.570.387.8722

Outside the US: +1.570.387.6997

techservice@sekisui-spi.com

[sekisui-spi.com](http://sekisui-spi.com)

## Membrane Pressing with KYDEX® 3D Laminates

TB-141-A

### Troubleshooting

#### Bowing of Parts:

On long and large parts, KYDEX® sheet tends to shrink as it cools, which may cause some bowing in the part. However, there are some steps that can be taken to combat warping or bowing of the substrate:

- Use a stronger or higher density substrate material.
- Use a thinner gauge of KYDEX® sheet. The thinnest gauge of KYDEX® sheet is .56mm (depended on product type).
- Some parts will allow for structural support on the back side; i.e. melamine, heavier gauge of KYDEX® sheet, etc.

#### Material Shrinking:

If material is shrinking and not adhering to the edges of the substrate it is an indication that the material is slightly cold. Increase your preheat time approximately 5 to 10 seconds. This will allow the material to reach the proper temperature, which in turn will allow the material to flow easier, producing a good finished part.

#### Webbing of Material:

If webbing in the formed part occurs, the sheet temperature could be too hot. Drop temperature in five-degree increments. If webbing continues, web catching blocks may need to be used. Place the blocks at the corners of the parts, approximately two fingers in distance from the part. This will pull the material away from the part corners, eliminating webbing.

#### SEKISUI SPI

ISO 9001 and 14001 Certified

#### Customer Service

6685 Low St, Bloomsburg, PA 17815 USA

Phone: 800.325.3133, +1.570.389.5810

Outside the US: +1.570.389.5814

Fax: 800.452.0155, +1.570.387.7786

Email: [info@sekisui-spi.com](mailto:info@sekisui-spi.com)

#### Technical Service

Phone: 800.682.8758

Fax: +1.570.387.8722

Outside the US: +1.570.387.6997

[techservice@sekisui-spi.com](mailto:techservice@sekisui-spi.com)

[sekisui-spi.com](http://sekisui-spi.com)

Because we cannot anticipate or control the many different conditions under which this information and our products may be used, we do not guarantee the applicability of the accuracy of this information or the suitability of our products in any given situation. Users should conduct their own tests to determine the suitability of each product for their particular purposes. Data in the physical property table represents typical values and are to serve only as a guide for engineering design. Results are obtained from specimens under ideal laboratory conditions. Right to change physical properties as a result of technical progress is reserved. THE PRODUCTS DISCUSSED ARE SOLD WITHOUT WARRANTY OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE, EITHER EXPRESSED OR IMPLIED, EXCEPT AS PROVIDED IN OUR STANDARD TERMS AND CONDITIONS OF SALE. Buyer assumes all responsibility for loss or damage arising from the handling and use of our products, whether done in accordance with directions or not. In no event shall the supplier or the manufacturer be liable for incidental or consequential damages. Also, statements concerning the possible use of our products are not intended as recommendations to use our products in the infringement of any patent. Consult local code and regulatory agencies for specific requirements regarding code compliance, transporting, processing, recycling and disposal of our product. Product not intended for use as a heat resistant surface. Texture, product grade and other conditions may cause variations in appearance.

This information supersedes all previously published data.